

642

Date: Thursday, 19/02/2009 1:56:34 PM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B
Job Number	: 45904A		
Estimate Number	: 10163		
P.O. Number	:	Part Number	: D206642241
This Issue	: 19/02/2009	S.O. No.	:
Prsht Rev.	: NC	Drawing Number	: D2650 REV F
First Issue	: / /	Project Number	: N/A
Previous Run	: 45234A	Drawing Revision	: F
	Type : SKIDTUBES	Material	:
Written By	:	Due Date	: 09/03/2009
Checked & Approved By	: <u>JNO 09.02.19</u>	Qty:	1 Um: Each
Comment	: Est Rev:M 04.12.02 Revised procedural steps KJ/JLM		

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-241

CHG003

N/A 18

2.0

D2620

Skidtube, 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2620 Bent Tube 3" OD

B3445 02

DP 9-2-19

3.0

D32861

Doubler



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-1

Doubler

B344286 ② M 9-2-23

4.0

D2647

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2647

Fwd Cap

B343846 BF 9-2-20

5.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

DP 9-2-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

DP 9-2-19

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M110676/M109213 BE 9-2-20

4-Grind weld flush to cap on top surface only.

BE 9-2-20

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

15-C'sink GHW rivet holes as per Dwg D2650

M 9-2-23

M 9-2-24

6.0

QC6



DIMENSIONAL CHECK

holes are with in 0.005"
from side to side



Comment: DIMENSIONAL CHECK

5 09/02/09 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125"

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

M
9-2-25

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

① M 9-2-25

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

NP 9-2-25

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C/sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

M
9-2-25

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

holes are still with in 0.005"
form size 2 size

S. 09/02/09 (cc)

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total: 52.0000 Each(s)

Pick:

*

Qty Part Number

Description Batch

52 CR3212-4-04 Rivet

M 110399

(57)

M 7875-3-44

(3)

M 9-2-25

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

D26543

Web



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2654-3 Web B 4590

D 11 9-2-25

14.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 9-2-25 Time: 6:00

Finish Date: 9-2-26 Time: 7:40 AM

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 0109883

Sikaflex expire date: 9-7-1

14
9-2-25

15.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

16.0

D2649

Cross Bolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2649 Crossbolt spacer B 44364 BE 09/02/26

17.0

D32863

Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-3 Spacer B 42862 BE 09/02/26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-remove alodine from around hole and prepare for welding

BE 09/02/26

2-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod M109213 BE 09/02/26

3-Grind welds flush as per Dwg D2650.

M 9-2-26

4-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/R SS Rod NONE BE 09/02/26

5-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr

M 9-2-27

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS3-3 Rivets M110625

② M 9-2-27

20.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Cherry Rivet

batch: M110139

② M 9-2-27

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate

① M 9-2-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:34 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

22.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

U 9-2-27

23.0

QC9 + QC10

VISUAL WELDING INSPECTION



QC10 509/02/07



Comment: VISUAL WELDING INSPECTION

QC9-PD 09.02.27

24.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

502/02/07 @

25.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

BL 09-03-2

26.0

POWDER COATING

POWDER COATING



M109996



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

START TIME:

6:20

OVEN TEMPERATURE:

320°

FINISH TIME:

6:50

FL 09/03/03

27.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



HL



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09-03-05

(X1)

28.0

D26483

Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

B44548

ump/BL

09/03/05

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:35 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

D265613

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-13

Wearshoe

B42772

UMD/BR

09/03/05

30.0

D265621

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-21

Wearshoe

B42776

UMD/BR

09/03/05

31.0

D265633

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2656-33

Wearshoe

B43806

UMD/BR

09/03/05

32.0

D34291

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3429-1

Wearpad

B44169

UMD/BR

09/03/05

33.0

ALS41032130

Insert



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

44 ALS4-1032-130 Inserts

m108606

or (see QSI 017)

UMD/BR

09/03/05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:35 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

AN960JD10L

Washer



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

46 AN960JD10L

Washer

M109632

ump/bl

09/03/05

35.0

MS27039108

Screw



Comment: Qty.: 46.0000 Each(s)/Unit Total : 46.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

46 MS27039-1-08

Screw

M110467

ump/bl

09/03/05

36.0

D26511

Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-1

Plugs

B43990

ump/bl

09/03/05

37.0

D26513

O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total : 18.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

18 D2651-3

O-Rings

B43849

ump/bl

09/03/05

38.0

MS27039406

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 MS27039-4-06

Screw

M109061

ump/bl

09/03/05

39.0

AN960JD416

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN960JD416

Washer

M108161

ump/bl

09/03/05

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:35 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

Sikaflex expire date:

M109883
09/11

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

mp/bl 09/03/05

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap

B 43801

mp/bl

09/03/05

42.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

Sikaflex expire date:

M109883
09/11

mp/bl 09/03/05

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch: M110454

91 09-03-06 (X)

43.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 09/03/06 (X)

44.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/03/06 (X)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/02/2009 1:56:35 PM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 45904A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

PACKAGING 1

PACKAGING RESOURCE #1



(1K)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location:

PPP Rev:

PPP

45904A

9/3/11

SA

46.0

QC21

FINAL INSPECTION/W/O RELEASE



09/03/12

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF
09-03-12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
17	18	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

F

F


NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/291 ADHESIVE PER DART QSI 015
- 11) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 12) DRILL 0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 13) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED


RELEASED
08-07-23

F	DRAWING UPDATED TO CURRENT STANDARDS. SHT 6 ADDED. ALL SECTION AND DETAIL VIEWS TRANSFERRED TO SHT 6. SHT 1 IN PL PART D2649 QTY UPDATED. SHT 6 SECT C-C GRIND INSTRUCTIONS DELETED FROM NOTE 7 (SEE NCR 239).	AJS	08.08.08
E	RMOVE CBORE, CHG DRILL, ADD CHAMFER	CP	08.03.30
D	REDRAW; INCCRP. DE09136/9153/9163 MOD GROUND HANDLING ON D2650-1/-3	CP	04.05.17
C	CHANGE HOLE PATTERN AND FRONT END	DS	97.10.29
B	AS MANUFACTURED CHANGES	DS	97.06.26
A	NEW ISSUE	DS	97.03.25
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE USA, INC PORT HADLOCK, WA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 1 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

NO. 15-10274
WORK ORDER
AMENDMENT
WITHOUT NOTICE
COPY
TO
ENTERING
CONTROLLED COPY

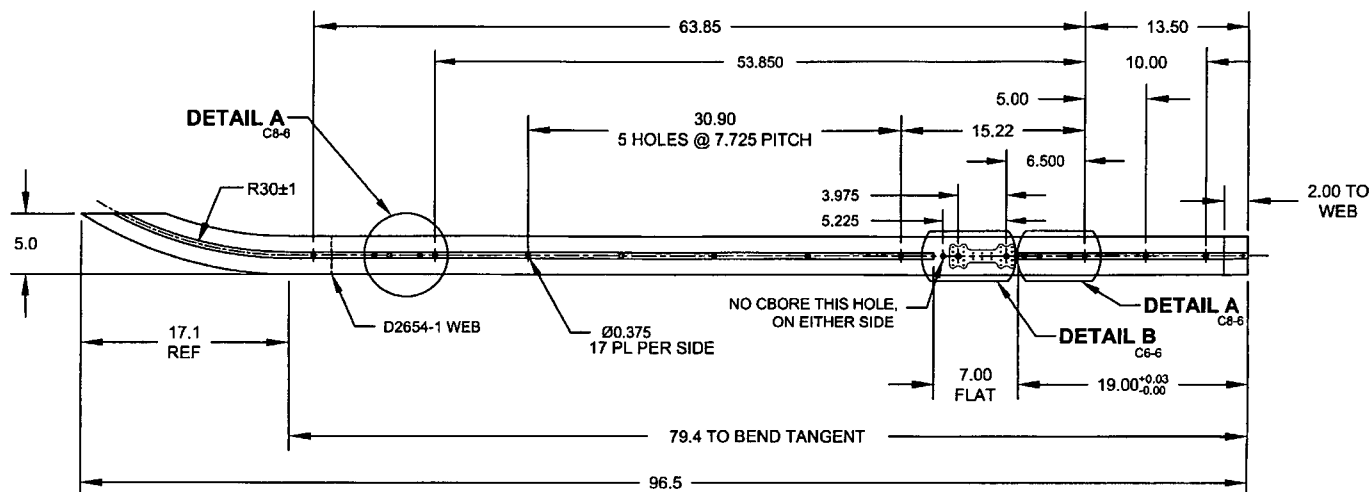

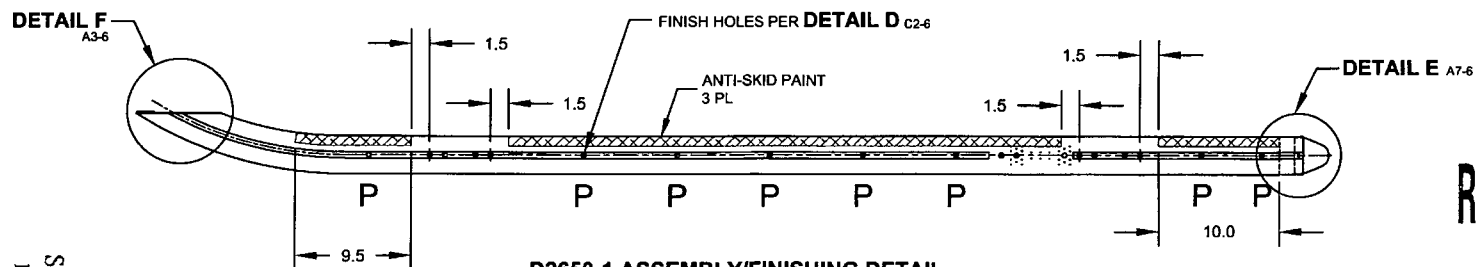


D2650-1 BENDING/DRILLING DETAIL




D2650-1 ASSEMBLY/FINISHING DETAIL


RELEASED
680922/111

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 4590114

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 2 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

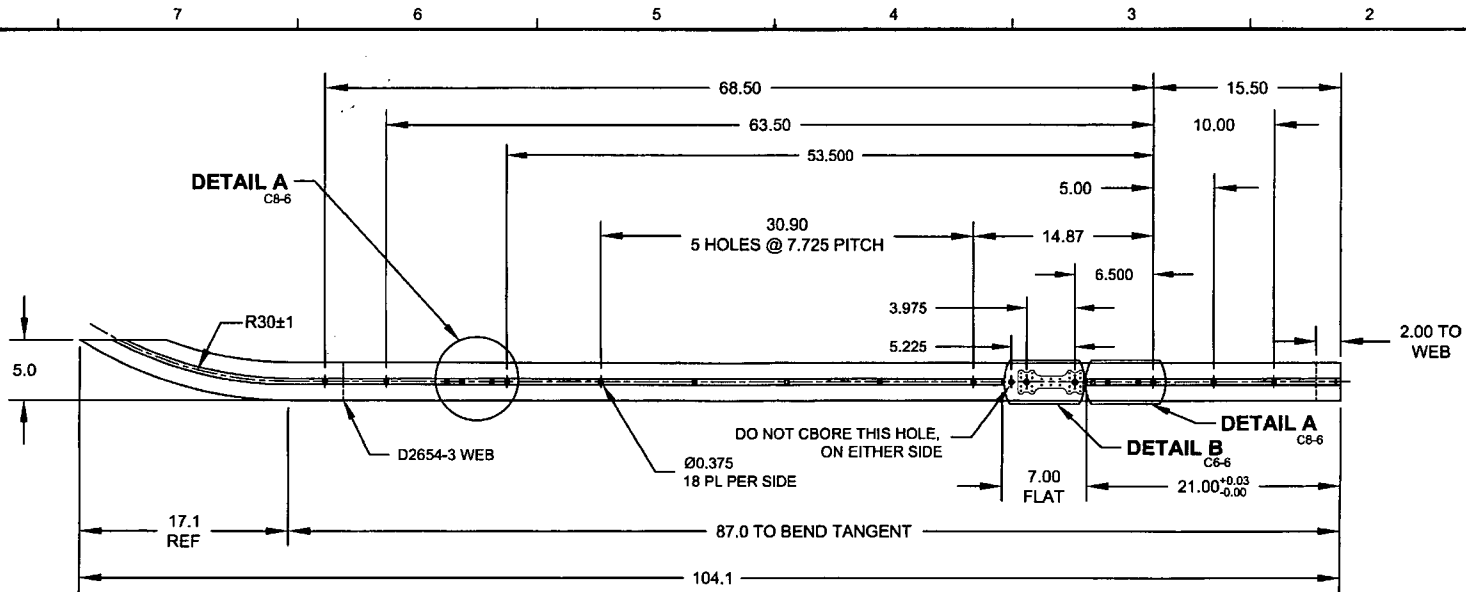

D2650-3 BENDING/DRILLING DETAIL

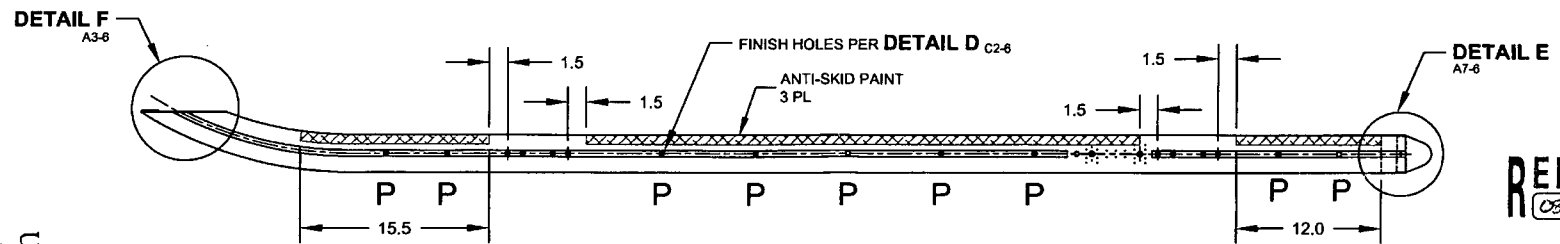


D2650-3 ASSEMBLY/FINISHING DETAIL


RELEASED
08-07-22 118

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 3 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO. 1590710

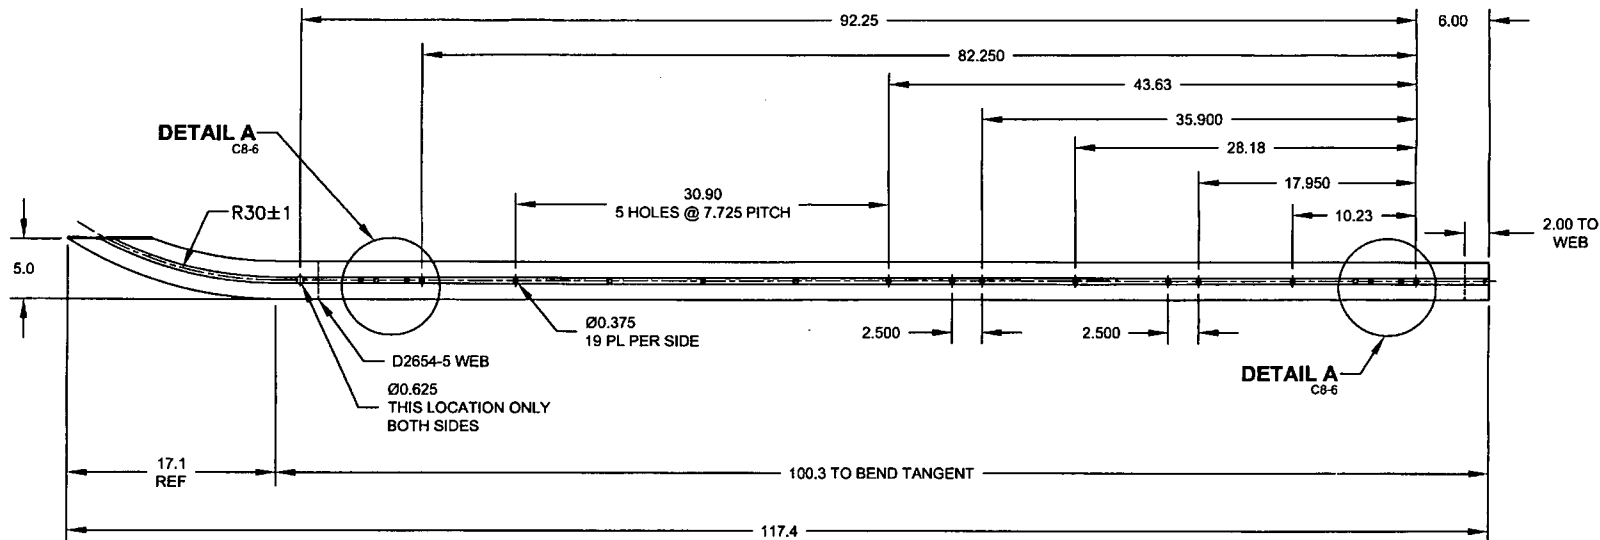

D2650-5 BENDING/DRILLING DETAIL

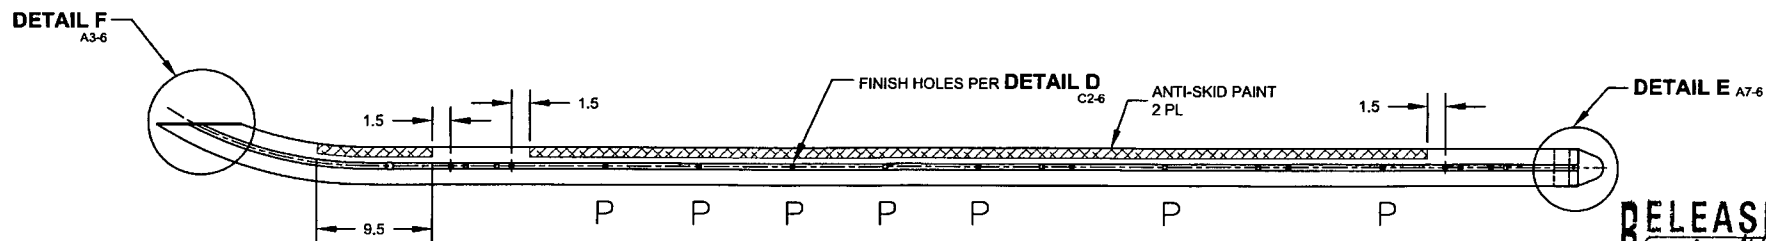


D2650-5 ASSEMBLY/FINISHING DETAIL

RELEASED
08.08.08


DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 4 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

NO. 1
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

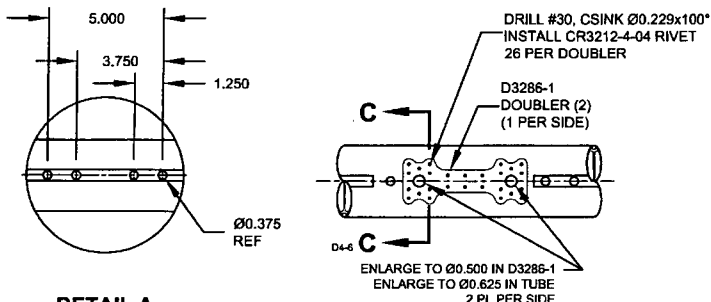


DETAIL A
SCALE 2X
C2-2
D7-2
C2-3
D7-3
C2-4
D7-4
C2-6
D8-5


DETAIL B
SCALE 2X
C3-2
C3-3

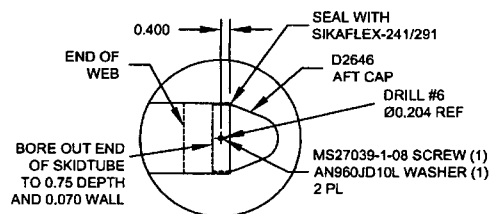


DETAIL E
SCALE 2X
B2-2
B2-3
B1-4
B1-5

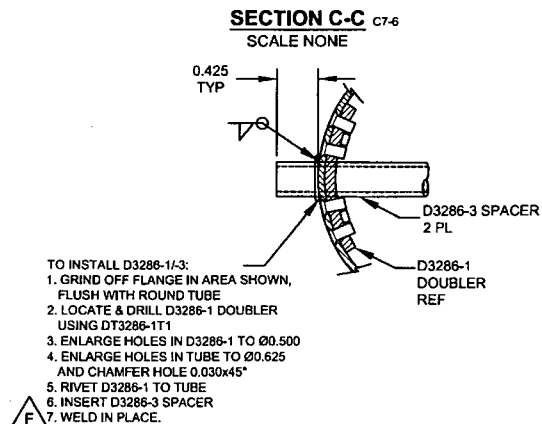

F

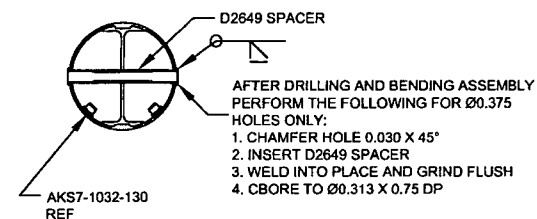

DETAIL D
FOR Ø0.375 HOLES ONLY
SCALE 3X
B4-2
B4-3
B4-4
B4-5

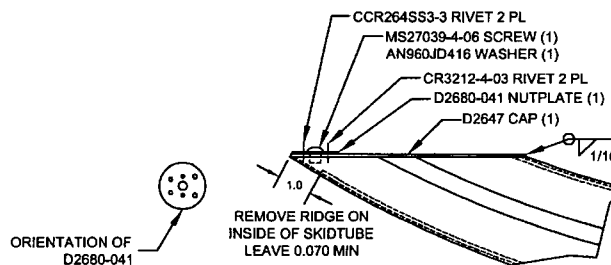

DETAIL F
SCALE NONE
B8-2
B8-3
B8-4
B8-5

- DETAIL F NOTES:**
- CUT TUBE LEVEL
 - REMOVE RIDGE ON FWD SIDE
 - LOCATE D2647 (TRIM AS NECESSARY)
 - WELD D2647 IN PLACE PER DART QSI 004
 - GRIND FLUSH
 - RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

RELEASED
08-08-08

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 6 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

NO. 100-1000
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
COPY

NO. 191

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliot
Job number: 45124 A
Part number: D058 670 041 / D206 642 241
Description: 04 58 / 206 skid
Welding Process: Tig[☒] Mig[]
Base material: Aluminium
Current: AC[] DC[]

TEST REQUIREMENTS AND RESULTS

Visual:
Penetration:

pass[☒] fail[]
pass[☒] fail[]

UNACCEPTABLE

Cracks:
Undercut:
Pin holes:
Overlap (cold lap)
Porosity (surface):
Coloration:

pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]
pass[☒] fail[]

Qualifier P. J. Dignel Date of Test Coupon 9-1-23
Welder Barclay Elliot Date of Test Coupon 9-1-23

The above named individual is qualified in accordance with AWS D17.1.2001 to weld